



-BRO- - UP -

West Elevation Notes:

- l. Clean stonework to the base of the plinth with a hard bristle brush and water.
- 2. Repoint missing and loose, and areas of hard cementitious mortar, with a soft lime hot-mixed mortar, with crushed stone dust to match the colour of the light grey stonework always.
- 3. Clean stonework with a hard bristle brush & water.
- 4. Apply Keim shelter coat to dragon's head and body in colour to match existing. Rake out areas of excessive cement pointing to top of dragon base.
- 5. Take off all water-retaining furry mosses to top of cill. No need to brush off lichens.
- b. Rake out all vegetation from joints and repoint (as Item 2).
- 7. Carry out plastic mortar repairs to establish run off to ledges. Need for micro-pinning of stonework in areas to West elevations, in areas of corners.
- 8. Infill cracks with mortar and stone dust, plastic mortar repairs and apply Keim shelter coat to consolidate surface and improve longevity. Some micro-prinning may be required perhaps to any loose surfaces, or indents.
- 9. Brush off delaminating stone face and apply Keim shelter coat to match stone colour to the whole pediment so it reads as one panel.
- 10. Replace broken glass panes. Allow for lead repairs.
- II. Brush down black soot to remove hard crust. Use a hard bristle brush (trial initially). It may be necessary to use a poultice, or laser clean if not.
- 12. Plug in holes within stonework or S/S insect mesh.
- 13. Review leadwork on scaffold, repairs to be specified after closer inspection. Allow contingency for repairs.
- 14. Re-tip the top finial with a s/s rod if required (asume to be ferrous potentially), clean the ironwork and repair any ferrous joints (confirm what metal this is to inform repairs, does not look like wrought iron as the dimensions are too fine is it copper or even bronze?).
- 15. Reinstate gas lamps or plug in holes and remove the ferrous fixings. Allow contingency for lamps to be installed with photovoltaic and electric light. Restored replicas of original metal lamps from photos.
- 16. See drawing 'East & West features: Sheet 2' for further information.

Phase 01 - Approach to Repairs (Issued for Committee Comment). West Elevation.

Issue: A (FMR) on 21.07.2021 for Trustees Meeting / Approval. B (FMR) on 26.08.2021